

CONTROL MICROSWITCHES: The right side control knob has microswitches behind it that are often found to be the source of trouble. However, Ron Whiston points out that the problem is often not a failure of the microswitches themselves, but simply that they are incorrectly positioned relative to the cam; turning the knob doesn't move the switch enough to make it click. Even though the mount holes are not slotted and are not intended to provide any position adjustment, merely loosening all the mount screws and holding the switches inward while tightening them back down will often correct all problems.

From the XJS Help book